

MAIL TO:

WATER SUPPLY BRANCH
DIVISION OF ENVIRONMENTAL CONTROL
P.O. BOX 1401
DOVER, DELAWARE 19903

**STATE OF DELAWARE
DEPARTMENT OF NATURAL RESOURCES
AND ENVIRONMENTAL CONTROL**

WELL COMPLETION REPORT MUST
BE RETURNED 30 DAYS AFTER
CONSTRUCTION DATE

PLEASE PRINT

WELL COMPLETION REPORT

PERMIT NO. 87508 LOCAL ID _____
OWNER Daniel C. Hall
CONSTRUCTION DATE July 23, 1991
PURPOSE: TEST PERMANENT
USE: DOMESTIC AGRICULTURAL
 COMMERCIAL INDUSTRIAL
 IRRIGATION PUBLIC
 OBSERVATION DEWATERING
 HEAT PUMP RECHARGE HEAT PUMP SUPPLY
 OTHER (Specify) _____
IS THIS A REPLACEMENT WELL? YES NO
ABANDONMENT DATE FOR OLD WELL _____
ABANDONMENT METHOD _____

DRILLING METHOD
 AUGERED BORED CABLE TOOL
 DRIVEN JETTED AIR ROTARY
 MUD ROTARY REVERSE WASHED
 OTHER (Specify) _____
TOTAL DEPTH DRILLED 74'

CASING SEQUENCE

INNER	OUTER
12" above	
67"	
24"	
PVC	

SCREEN SEQUENCE

INNER	OUTER
67"	
74"	
24"	
PVC	


WRITTEN APPROVAL FOR SCREENING/
GRAVEL PACKING MORE THAN ONE FOOT
DEEP MUST BE OBTAINED FROM DNREC.

GROUT TYPE: CEMENT BENTONITE CLAY
OTHER: _____
FROM 0 TO 20 FEET
NON-GROUT BACKFILL OF WELL ANNULUS
TYPE Native FROM 20 TO 62 FEET
GRAVEL PACK: TYPE #4 Mobile
FROM 62 TO 74 FEET
STATIC WATER LEVEL: DATE July 23, 1991
11 FT. (Below, above) GROUND SURFACE
PUMPING WATER LEVEL: 20 FT. BELOW GRADE
AFTER 2 HOURS AT 70 GPM.

TELL HEAD COMPLETION:
PE: PITLESS ADAPTOR
INCHES ABOVE GRADE. _____

TYPE OF PERMANENT PUMP INSTALLED:
PUMP MANUFACTURE Goulds
RATED CAPACITY (GPM) 12
PUMP INTAKE SETTING _____ FT. BELOW GRADE
THE COMPLETED WELL IS?
A. AT LEAST 15' FROM ANY FOUNDATION YES NO
B. AT LEAST 50' FROM ANY SEPTIC TANK YES NO
C. AT LEAST 10' FROM TOWN SEWER LINE YES NO
D. AT LEAST 100' FROM THE NEAREST EDGE OF ANY TILE FIELD YES NO

THE NEAREST NEIGHBORS (CIRCLE ONE)
SEPTIC TILE FIELD CESSPOOL OR PRIVY
IS 120' FROM COMPLETED WELL
IS COMPLETED WELL LOCATED AS SHOWN ON APPLICATION FORM?
IF NO, DESCRIBE LOCATION CHANGE OR OTHER COMMENTS.

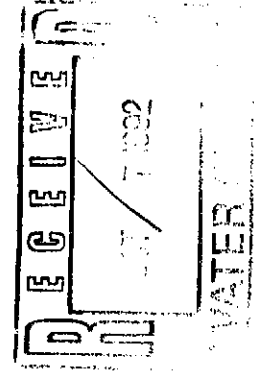

DRILLERS LOG DESCRIPTION	TOP OF STRATA	BOTTOM OF STRATA
Top Soil	0	1
Fine to medium	1	7
Yellow to orange sandstones		
Fine to medium light	7	27
yellow sand		
Fine to coarse light	27	64
orange sand		
Fine to coarse orange	64	74
sand + large gravel		

SUPPLEMENTAL DRILLERS LOG ATTACHED YES NO
PAGE 1 OF 2 PAGES
COMPANY NAME White Drilling Corp
SIGNATURE OF DRILLER IN CHARGE: Allen White DATE July 26, 1991