

MAIL TO:
 WATER SUPPLY BRANCH
 DIVISION OF ENVIRONMENTAL CONTROL
 P.O. BOX 1401
 DOVER, DELAWARE 19903

**STATE OF DELAWARE
 DEPARTMENT OF NATURAL RESOURCES
 AND ENVIRONMENTAL CONTROL**

WELL COMPLETION REPORT MUST
 BE RETURNED 30 DAYS AFTER
 CONSTRUCTION DATE

WELL COMPLETION REPORT

PLEASE PRINT

PERMIT NO. 87635 LOCAL ID Alw-2
 OWNER Uhasic Foods Inc
 CONSTRUCTION DATE 7/19/91
 PURPOSE: TEST PERMANENT
 USE: DOMESTIC AGRICULTURAL
 COMMERCIAL INDUSTRIAL
 IRRIGATION PUBLIC
 OBSERVATION DEWATERING
 HEAT PUMP RECHARGE HEAT PUMP SUPPLY
 OTHER (Specify) Recovery Well
 IS THIS A REPLACEMENT WELL? YES NO
 ABANDONMENT DATE FOR OLD WELL NA
 ABANDONMENT METHOD NA

DRILLING METHOD

- AUGERED BORED CABLE TOOL
 DRIVEN JETTED AIR ROTARY
 MUD ROTARY REVERSE WASHED
 OTHER (Specify) _____

TOTAL DEPTH DRILLED 50'

CASING SEQUENCE

INNER	OUTER
<u>42</u>	
<u>-20</u>	
<u>6"</u>	
<u>PVC</u>	

SCREEN SEQUENCE

INNER	OUTER
<u>-20</u>	
<u>-40</u>	
<u>6"</u>	
<u>Steel</u>	

WRITTEN APPROVAL FOR SCREENING/
 GRAVEL PACKING MORE THAN ONE AQU-
 IFER MUST BE OBTAINED FROM DNREC.

GROUT TYPE: CEMENT BENTONITE CLAY

OTHER: _____
 FROM 0 TO 17 FEET
 NON-GROUT BACKFILL OF WELL ANNULUS
 TYPE _____ FROM _____ TO _____ FEET

GRAVEL PACK: TYPE _____ FEET
 FROM 17 TO 50 FEET
 STATIC WATER LEVEL: DATE 7/19/91 8.5.91
-20 FT. (Below, above) GROUND SURFACE
 PUMPING WATER LEVEL: 31 FT. BELOW GRADE
 AFTER 1 HOURS AT 78 GPM.

WELL HEAD COMPLETION:

TYPE: PITLESS ADAPTOR
 OTHER Well to be Above gravel well Seal
24 INCHES ABOVE GRADE.

TYPE OF PERMANENT PUMP INSTALLED:

PUMP MANUFACTURE Net installed yet
 RATED CAPACITY (GPM) _____
 PUMP INTAKE SETTING _____ FT. BELOW GRADE


THE COMPLETED WELL IS?

YES NO

- A. AT LEAST 15' FROM ANY FOUNDATION
 B. AT LEAST 50' FROM ANY SEPTIC TANK
 C. AT LEAST 10' FROM TOWN SEWER LINE
 D. AT LEAST 100' FROM THE NEAREST EDGE OF ANY TILE FIELD

THE NEAREST NEIGHBORS (CIRCLE ONE)

SEPTIC TILE FIELD CESSPOOL OR PRIVY
 IS _____ FROM COMPLETED WELL.
 IS COMPLETED WELL LOCATED AS SHOWN ON APPLICATION FORM?
 IF NO, DESCRIBE LOCATION CHANGE OR OTHER COMMENTS.

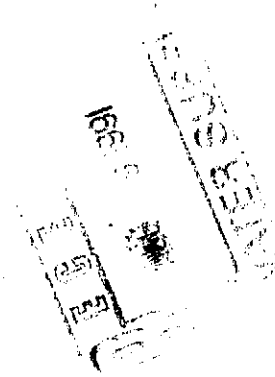

DRILLERS LOG DESCRIPTION	TOP OF STRATA	BOTTOM OF STRATA
<u>Top Soil</u>	<u>0</u>	<u>1</u>
<u>Brown Fine Sandy Clay</u>	<u>1</u>	<u>5</u>
<u>Thin Fine Striped J</u>	<u>5</u>	<u>17</u>
<u>org/fin Fine med sand</u>	<u>17</u>	<u>21</u>
<u>White Fine to Gr Sand</u>	<u>21</u>	<u>23</u>
<u>White Fine Sand</u>	<u>23</u>	<u>25</u>
<u>White/fin, fine/Gr Sand</u>	<u>25</u>	<u>40</u>
<u>org/fin Fine Sand</u>	<u>40</u>	<u>50</u>

SUPPLEMENTAL DRILLERS LOG ATTACHED YES NO

PAGE 1 OF _____ PAGES

COMPANY NAME F. Sullivan DATA INC.

SIGNATURE OF DRILLER IN CHARGE: F. Sullivan DATE 8.7.91